


Exterior

Interior

Dymonic 100 applied 1/16" (60 mils) thick with a 3/4" contact to face of panel

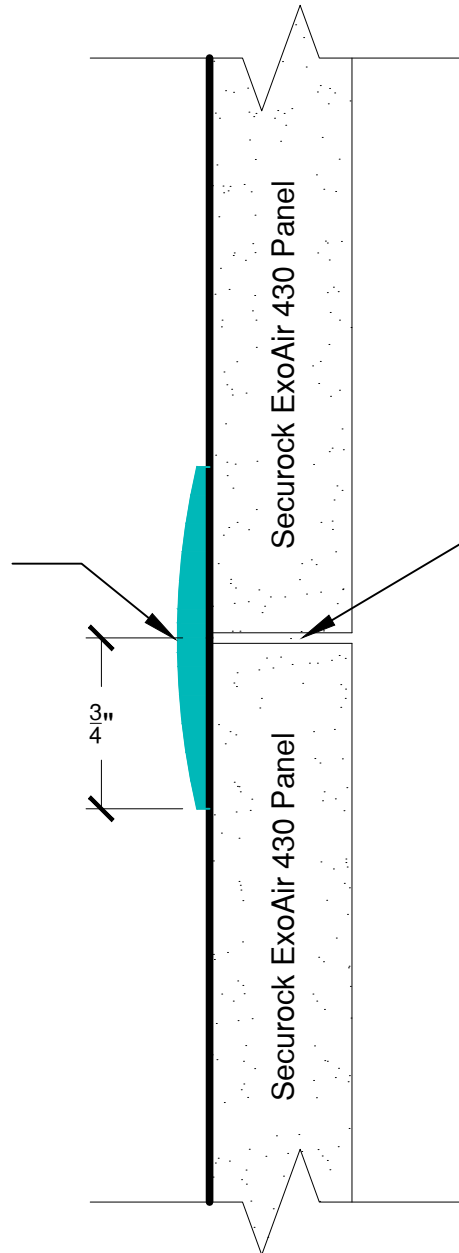

Gaps between boards shall not exceed 1/8", gaps greater than 1/8" but less than 1/2" shall be filled with Dymonic 100 sealant as fill material prior to detailing board. Joint to be finished per board joint section below. If gap exceeds 1/2", panel must be repositioned or repaired per repair instructions listed in section 24 of the Installation Instructions.

NOTES:

- Spectrem 1 is an alternative to Dymonic 100, but can not be used with an adhesively applied cladding

See securockexoair.com for the most up-to-date product information

This detail is intended for conceptual purposes only. Must be reviewed by a project/design professional

The following trademarks used herein are owned by USG Corporation or its subsidiaries: SECUROCK, USG, USG in stylized letters. The following trademarks used herein are owned by Tremco Incorporated or its subsidiaries: Tremco, ExoAir, Spectrem, Dymonic, Proglaze, Vulkem.



PERFORMANCE BUILT IN
www.securockexoair.com

United States Gypsum Company
550 West Adams Street
Chicago, IL 60661

USG Technical & Customer Support:
800.USG.4YOU (874-4968)

Tremco Commercial Sealants & Waterproofing
3735 Green Road
Beachwood, OH 44122

Tremco Technical Support:
866.209.2404

SECUROCK® ExoAir® 430 Panel

Project:
Detail: Board Joint

Drawn by: KAB

Approved by: DM

Scale: NTS

File Name:
12969

Date: 3/29/2017

Rev #
00